



Blackstone Academy totals 30,000 square feet and consists of the school type(s) detailed below. School(s) were visited three times during the Statewide Facilities Assessment by teams of specialists from April-June 2016. This report provides LEA summary findings for the statewide assessment program.

### School Type by Count



School Type	SqFt
High School	30,000
<b>Total:</b>	<b>30,000</b>

### 82.3 % Utilization




### Demographics

Enrollment is projected to increase by 40.2% over the next 10 years in Charter Schools. The total LEA enrollment at 1 school(s) is 247 students with a total capacity of 300 as reported by the LEA. Utilization is calculated by dividing enrollment by capacity, resulting in 82.3% utilization at Blackstone Academy.

### Educational Program Space Analysis

In Blackstone Academy there are 17 instructional spaces; of these spaces 5.9% meet or exceed the space size standards. Of the total current deficiencies identified, \$504,271 are related to the educational program space assessment. Addressing these identified deficiencies will improve the learning environment and bring the school(s) in the district closer to 21st century learning facilities.

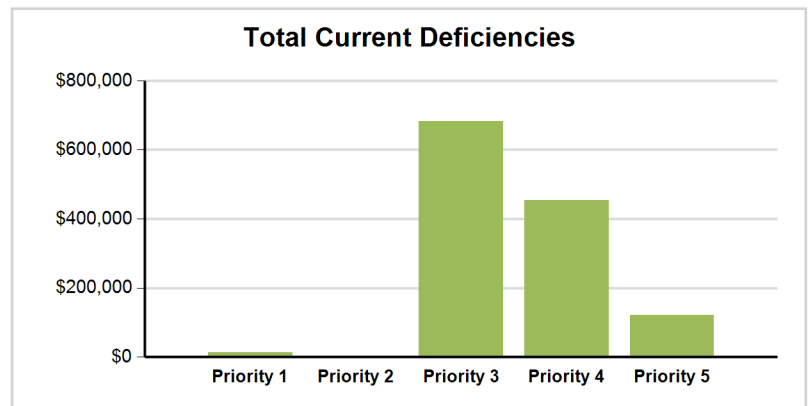

### Five Year Need Summary

The current deficiencies total \$1,268,291, with 53.8% categorized as Priority 3 and another 35.7% as Priority 4. The building systems with the highest current deficiency costs are Technology and Interior.

School(s) with Greatest Need	Combined 5-Year Need
Blackstone Academy Charter School	\$1,722,638

The projected life cycle need in Years 1 through 5 is \$454,347. It is anticipated that the majority of the need will occur in Year 5. School(s) with the greatest need are represented in the adjacent table and make up 100.0% of the combined 5-Year need at Blackstone Academy.


### Five Year Facility Condition Index (FCI)

For master planning purposes, the total current deficiencies, less new construction, and the first 5 years of projected life cycle needs were combined. This provides an understanding of the current needs of a facility as well as the projected needs in the near future. A 5-Year FCI was calculated by dividing the 5-Year need by the total replacement cost. The 5-Year need is \$1,722,638 with a district replacement value of \$10,800,000. The resulting 5-Year FCI is 16.0%.

### 5-Year FCI Ranges



LEA Summary Data					
Gross SqFt	Avg Year Built	Current Deficiencies (Less New Construction)	Life Cycle Year 1-5 Total	Total 5-Year Need (Year 1-5 + Current Defs)	5-Year FCI
30,000	1965	\$1,268,291	\$454,347	\$1,722,638	16.0%

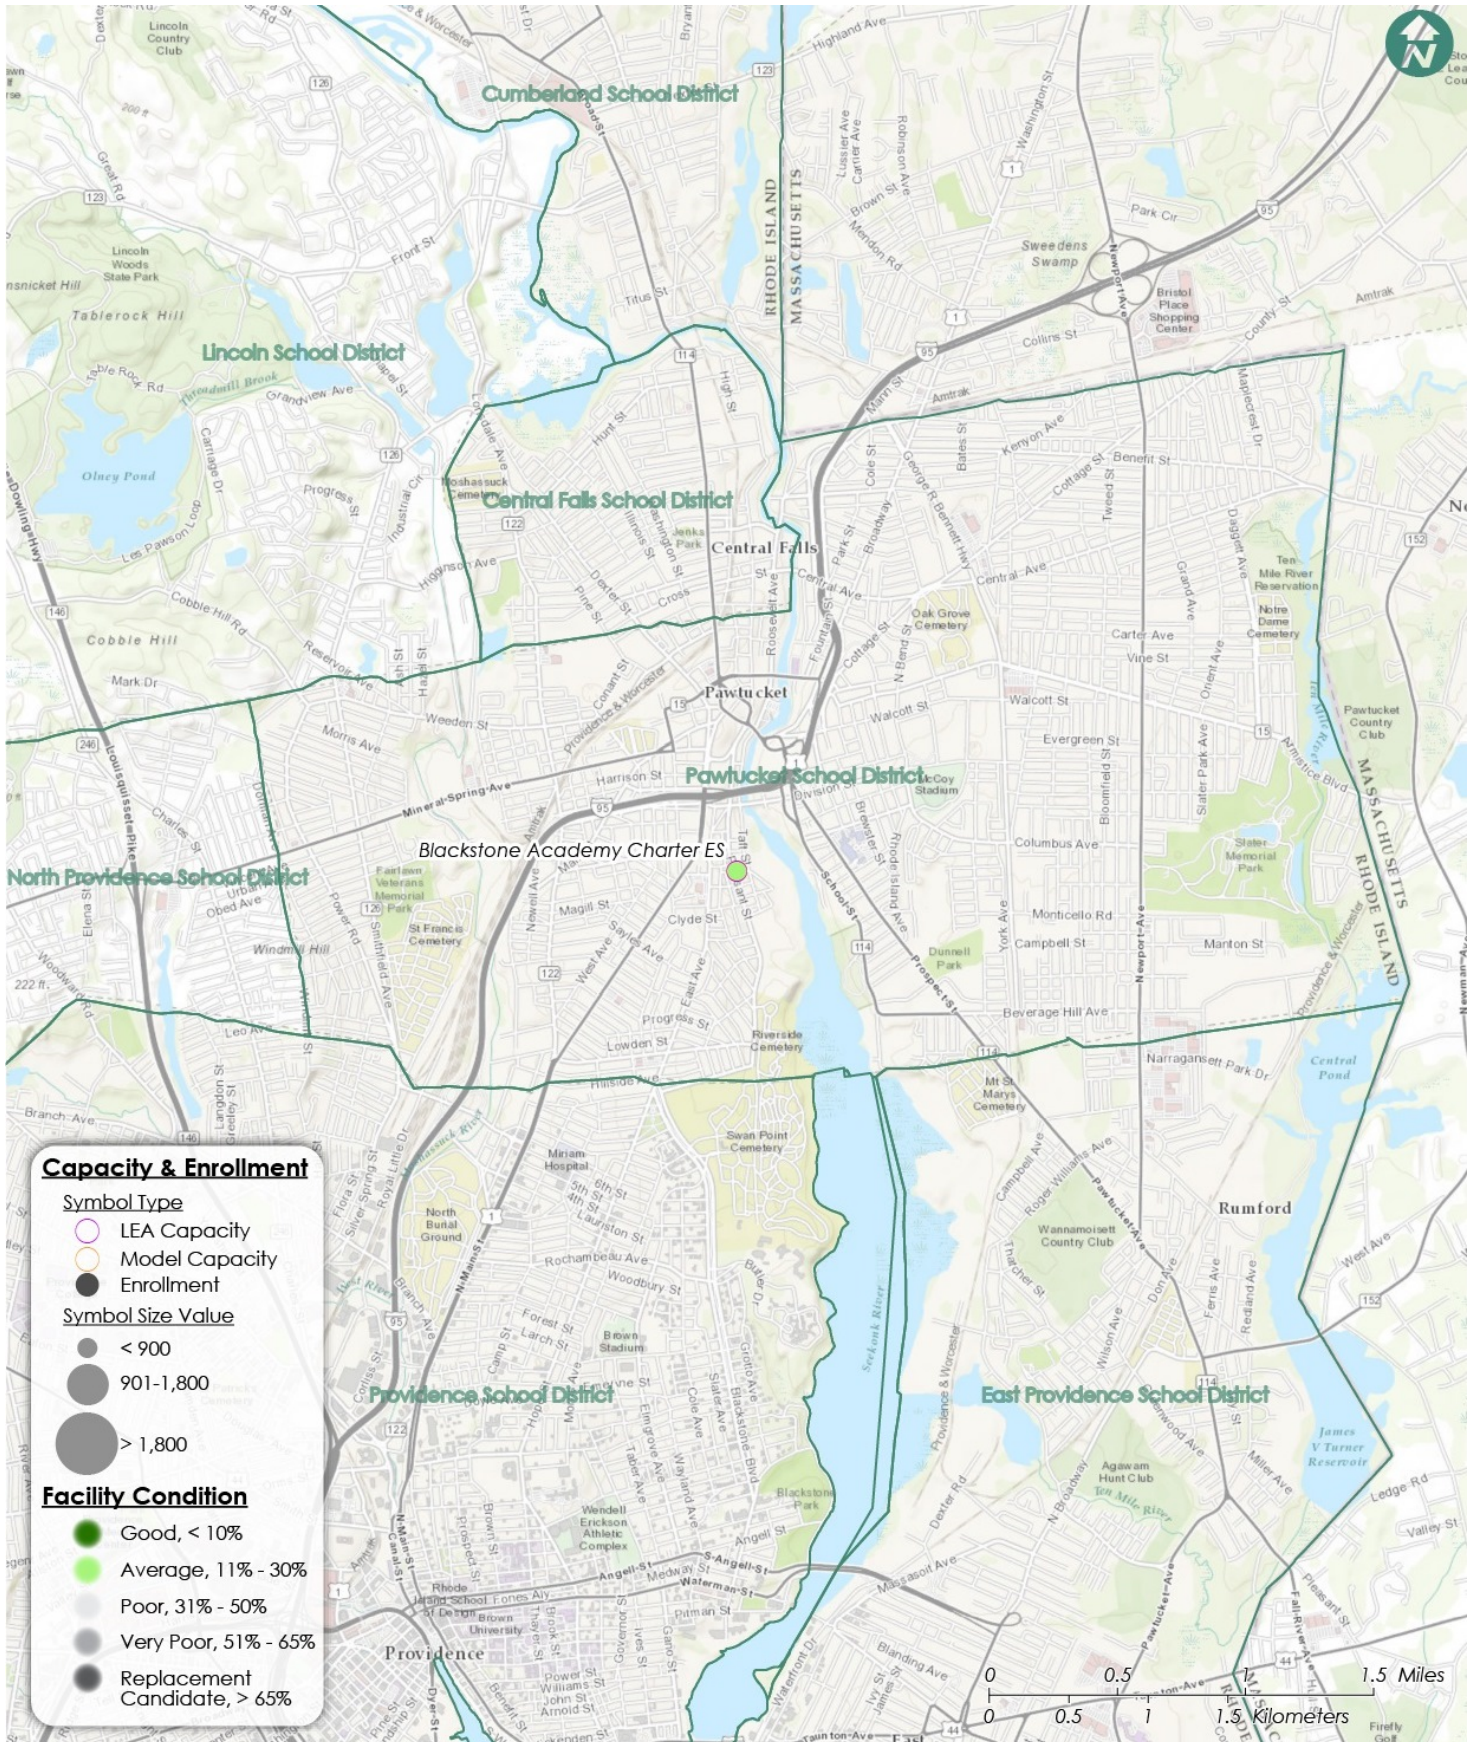



# Facility Condition Assessment

Charter - Blackstone Academy Charter School

June 2017

334 Pleasant Street, Pawtucket, RI 02860





## Introduction

Blackstone Academy Charter School, located at 334 Pleasant Street in Pawtucket, Rhode Island, was built in 1965. It comprises 30,000 gross square feet. Each school across the district was visited three times during the Facility Condition Assessments by three teams of specialists in the spring/summer of 2016.

Blackstone Academy Charter School serves grades 9 - 12, has 17 instructional spaces, and has an enrollment of 247. Instructional spaces are defined as rooms in which a student receives education. The LEA reported capacity for Blackstone Academy Charter School is 300 with a resulting utilization of 82%.

For master planning purposes a 5-year need was developed to provide an understanding of the current need as well as the projected needs in the near future. For Blackstone Academy Charter School the 5-year need is \$1,722,638. The findings contained within this report resulted from an assessment of building systems performed by building professionals experienced in disciplines including: architecture, mechanical, plumbing, electrical, acoustics, hazardous materials, and technology infrastructure.



Figure 1: Aerial view of Blackstone Academy Charter School



## Approach and Methodology

A facility condition assessment evaluates each building's overall condition. Two components of the facility condition assessment are combined to total the cost for facility need. The two components of the facility condition assessment are current deficiencies and life cycle forecast.

**Current Deficiencies:** Deficiencies are items in need of repair or replacement as a result of being broken, obsolete, or beyond useful life. The existing deficiencies that currently require correction are identified and assigned a priority. An example of a current deficiency might include a broken lighting fixture or an inoperable roof top air conditioning unit.

**Life Cycle Forecast:** Life cycle analysis evaluates ages of a building's systems to forecast system replacement as they reach the end of serviceable life. An example of a life cycle system replacement is a roof with a 20-year life that has been in place for 15 years and may require replacement in five years.

## Discipline Specialists

All assessment teams produced current deficiencies associated with each school. The assessment for the school facilities at the Rhode Island Department of Education included several specialties:

**Facility Condition Assessment:** Architectural, mechanical, and electrical engineering professionals observed conditions via a visual observation that did not include intrusive measures, destructive investigations, or testing. Additionally, the assessment incorporated input provided by district facilities and maintenance staff where applicable. The assessment team recorded existing conditions, identified problems and deficiencies, documented corrective action and quantities, and identified the priority of the repair in accordance with parameters defined during the planning phase. The team took digital photos at each school to better identify significant deficiencies.

**Technology:** Technology specialists visited RIDE facilities and met with technology directors to observe and assess each facility's technology infrastructure. The assessment included network architecture, major infrastructure components, classroom instructional systems, necessary building space and support for technology. The technology assessment took into account the desired technology outcome and best practices and processes to ensure results can be attained effectively.

**Hazardous Materials:** Schools constructed prior to 1990 were assessed by specialists to identify the presence of hazardous materials. The team focused on identifying asbestos containing building materials (ACBMs), lead-based painted (LBP) areas, polychlorinated biphenyls (PCBs), and chlorofluorocarbons (CFCs). As part of an indoor air and exterior air quality assessment, the team noted evidence of mold, water intrusion, mercury, and oil and hazardous materials (OHMs) exposure. If sampling and analysis was required, these activities were recommended but not included in the scope of work.

**Traffic:** A traffic specialist performed an in-office review of aerial imagery of the traffic infrastructure around the facilities in accordance with section 1.05-7 in the Rhode Island School Construction Regulations and reviewed data collected on site during the facility condition assessment. Based on this information, deficiencies and corrective actions were identified. High problem areas were identified for consideration of more detailed site-specific study and analysis in the future.

**Acoustics:** Specialists assessed each school's acoustics, including architectural acoustics, mechanical system noise and vibration, and environmental noise. The assessment team evaluated room acoustics with particular attention to the intelligibility of speech in learning spaces, interior and exterior sound isolation, and mechanical system noise and vibration control.

**Educational Program Space Assessment:** Teams evaluated schools to ensure that that all spaces adequately support the districts educational program. Standards are established for each classroom type or instructional space. Each space is evaluated to determine if it meets those standards and a listing of alterations that should be made to make the space a better environment for teaching and learning was created.



## System Summaries

The following tables summarize major building systems at the Blackstone Academy Charter School campus, identified by discipline and building.

### Site

The site level systems for this campus include:

<b>Site</b>	Asphalt Parking Lot Pavement
	Concrete Pedestrian Pavement

### Building Envelope

The exterior systems for the building(s) at this campus includes:

<b>01 - Main Building:</b>	Brick Exterior Wall
	CMU Exterior Wall
	Aluminum Exterior Windows
	Steel Exterior Entrance Doors
	Storefront Entrance Doors
	Overhead Exterior Utility Doors

The roofing for the building(s) at this campus consists of:

<b>01 - Main Building:</b>	Built-Up Roofing With Ballast
----------------------------	-------------------------------

### Interior

The interior systems for the building(s) at this campus include:

<b>01 - Main Building:</b>	Steel Interior Doors
	Wood Interior Doors
	Interior Door Hardware
	Exposed Metal Structure Ceiling
	Suspended Acoustical Grid System
	Suspended Acoustical Ceiling Tile
	Ceramic Tile Wall
	CMU Wall
	Interior Wall Painting
	Concrete Flooring
	Ceramic Tile Flooring
	Wood Flooring
	Metal Ceiling Panel

### Mechanical

The mechanical systems for the building(s) at this campus include:

<b>01 - Main Building:</b>	DDC Heating System Controls
	Ductwork



<b>01 - Main Building:</b>	15 Ton DX Gas Roof Top Unit
	40 Ton DX Gas Roof Top Unit
	VAV Boxes / Terminal Device
	4'x6' Ventilator/Relief Vent
	Small Roof Exhaust Fan
	Fire Sprinkler System

## Plumbing

The plumbing systems for the building(s) at this campus include:

<b>01 - Main Building:</b>	4" Backflow Preventers
	Gas Piping System
	9.4 GPM Instant Water Heater
	Domestic Water Piping System
	Classroom Lavatories
	Mop/Service Sinks
	Refrigerated Drinking Fountain
	Restroom Lavatories
	Toilets
	Urinals

## Electrical

The electrical systems for the building(s) at this campus include:

<b>01 - Main Building:</b>	1,500 KVA Transformer
	75 KVA Transformer
	1600 Amp Distribution Panel
	Panelboard - 120/208 225A
	Panelboard - 120/240 225A
	Panelboard - 277/480 400A
	Electrical Disconnect
	Light Fixtures
	Building Mounted Lighting Fixtures



## Facility Deficiency Priority Levels

Deficiencies were ranked according to five priority levels, with Priority 1 items being the most critical to address:

**Priority 1 – Mission Critical Concerns:** Deficiencies or conditions that may directly affect the school's ability to remain open or deliver the educational curriculum. These deficiencies typically relate to building safety, code compliance, severely damaged or failing building components, and other items that require near-term correction. An example of a Priority 1 deficiency is a fire alarm system replacement.

**Priority 2 - Indirect Impact to Educational Mission:** Items that may progress to a Priority 1 item if not addressed in the near term. Examples of Priority 2 deficiencies include inadequate roofing that could cause deterioration of integral building systems, and conditions affecting building envelopes, such as roof and window replacements.

**Priority 3 - Short-Term Conditions:** Deficiencies that are necessary to the school's mission but may not require immediate attention. These items should be considered necessary improvements required to maximize facility efficiency and usefulness. Examples of Priority 3 items include site improvements and plumbing deficiencies.

**Priority 4 - Long-Term Requirements:** Items or systems that may be considered improvements to the instructional environment. The improvements may be aesthetic or provide greater functionality. Examples include cabinets, finishes, paving, removal of abandoned equipment, and educational accommodations associated with special programs.

**Priority 5 - Enhancements:** Deficiencies aesthetic in nature or considered enhancements. Typical deficiencies in this priority include repainting, replacing carpet, improved signage, or other improvements to the facility environment.



# Facility Condition Assessment

Charter - Blackstone Academy Charter School

The following chart summarizes this site's current deficiencies by building system and priority. The listing details current deficiencies including deferred maintenance, functional deficiencies, code compliance, capital renewal, hazardous materials and technology categories.

Table 1: System by Priority

System	Priority					Total	% of Total
	1	2	3	4	5		
Site	-	-	\$95,892	\$67,764	\$69,827	\$233,483	18.41 %
Roofing	-	-	-	-	-	\$0	0.00 %
Structural	-	-	-	-	-	\$0	0.00 %
Exterior	-	-	-	-	-	\$0	0.00 %
Interior	-	-	-	\$363,367	-	\$363,367	28.65 %
Mechanical	-	-	-	\$21,838	-	\$21,838	1.72 %
Electrical	\$1,403	-	-	-	\$31,547	\$32,950	2.60 %
Plumbing	-	-	-	-	\$10,510	\$10,510	0.83 %
Fire and Life Safety	\$11,332	-	-	-	-	\$11,332	0.89 %
Technology	-	-	\$586,313	-	-	\$586,313	46.23 %
Conveyances	-	-	-	-	-	\$0	0.00 %
Specialties	-	-	-	-	\$8,499	\$8,499	0.67 %
<b>Total</b>	\$12,734	\$0	\$682,205	\$452,969	\$120,383	\$1,268,291	

\*Displayed totals may not sum exactly due to mathematical rounding

The building systems with the most need include:

Technology	-	\$586,313
Interior	-	\$363,367
Site	-	\$233,483

The chart below represents the building systems and associated deficiency costs.

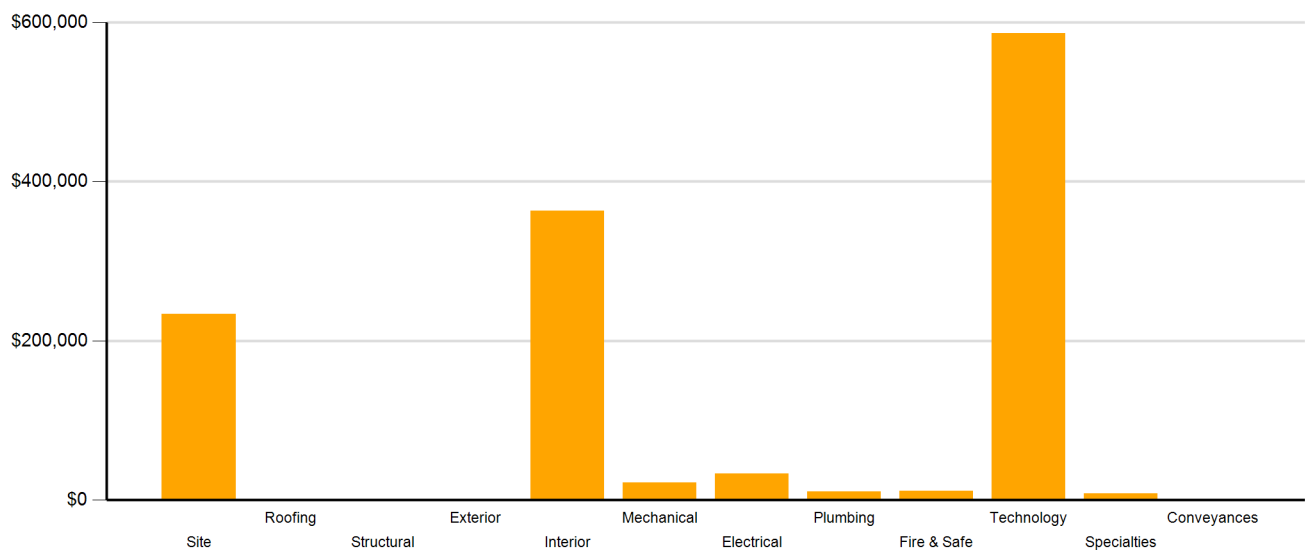


Figure 2: System Deficiencies



## Current Deficiencies by Category

Deficiencies have been further grouped according to the observed category.

- **Acoustics** deficiencies relate to room acoustics, sound insulation, and mechanical systems and vibration control modeled after ANSI/ASA Standard S12.60-2010 and ASHRAE Handbook, Chapter 47 on Sound and Vibration Control.
- **Barrier to Accessibility** deficiencies relate to the Americans with Disabilities Act and the Rhode Island Governors Commission on Disability. Additional items related to accessibility may be included other categories.
- **Capital Renewal** items have reached or exceeded serviceable life and require replacement. These are current and do not include life cycle capital renewal forecasts. Also included are deficiencies correcting planned work postponed beyond its regular life expectancy.
- **Code Compliance** deficiencies related to current codes. Many may fall under grandfather clauses, which allow buildings to continue operating under codes effective at the time of construction. However, there are instances where the level of renovation requires full compliance which are reflected in the master plan.
- **Educational Adequacy** deficiencies identify where facilities do not align with the Basic Education Program and the RIDE School Construction Regulations.
- **Functional Deficiencies** are deficiencies for components or systems that have failed before the end of expected life or are not the right application, size, or design.
- **Hazardous Materials** include deficiencies for building systems or components containing potentially hazardous material. The team focused on identifying asbestos containing building materials (ACBMs), lead based painted (LBP) areas, polychlorinated biphenyls (PCBs), and chlorofluorocarbons (CFCs). As part of an indoor air and exterior air quality assessment, the team noted evidence of mold, water intrusion, mercury, and oil and hazardous materials (OHMs) exposure. With other scopes of work there may be other costs associated with hazardous materials.
- **Technology** deficiencies relate to network architecture, technology infrastructure, classroom systems, and support. Examples of technology deficiencies include: security cameras, secure electronic access, telephone handsets, and dedicated air conditioning for telecommunication rooms.
- **Traffic** deficiencies relate to vehicle or pedestrian traffic, such as bus loops, crosswalks, and pavement markings.



The following chart and table represent the deficiency category by priority. This listing includes current deficiencies for all building systems.

Table 2: Deficiency Category by Priority

Category	Priority					Total
	1	2	3	4	5	
Acoustics	-	-	-	-	-	\$0
Barrier to Accessibility	-	-	\$87,771	-	-	\$87,771
Capital Renewal	-	-	\$8,121	\$39,435	-	\$47,556
Code Compliance	-	-	-	-	-	\$0
Educational Adequacy	\$12,734	-	\$16,997	\$354,157	\$120,383	\$504,271
Functional Deficiency	-	-	-	-	-	\$0
Hazardous Material	-	-	-	\$59,377	-	\$59,377
Technology	-	-	\$569,315	-	-	\$569,315
Traffic	-	-	-	-	-	\$0
<b>Total</b>	\$12,734	\$0	\$682,205	\$452,969	\$120,383	\$1,268,291

\*Displayed totals may not sum exactly due to mathematical rounding

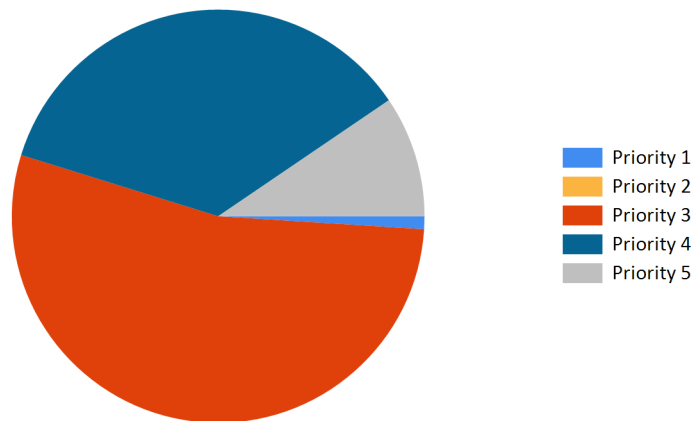


Figure 3: Current deficiencies by priority



### Life Cycle Capital Renewal Forecast

During the facility condition assessment, assessors inspected all major building systems. If a need for immediate replacement was identified, a deficiency was created with the estimated repair costs. The identified deficiency contributes to the facility's total current repair costs.

Capital planning scenarios span multiple years, as opposed to being constrained to immediate repairs. Construction projects may begin several years after the initial facility condition assessment. Therefore, in addition to the current year repair costs, it is necessary to forecast the facility's future costs using a 5-year life cycle renewal forecast model.

Life cycle renewal is the projection of future building system costs based upon each individual system's expected serviceable life. Building systems and components age over time, eventually break down, reach the end of their useful lives, and may require replacement. While an item may be in good condition now, it might reach the end of its life before a planned construction project occurs.

The following chart shows all current deficiencies and the subsequent 5-year life cycle capital renewal projections. The projections outline costs for major building systems in which a component is expected to reach the end of its useful life and require capital funding for replacement.

Table 3: Capital Renewal Forecast

System	Current Deficiencies	Life Cycle Capital Renewal Projections					LC Yr. 1-5 Total	Total 5-Year Need
		Year 1 2017	Year 2 2018	Year 3 2019	Year 4 2020	Year 5 2021		
Site	\$233,483	\$0	\$0	\$0	\$0	\$0	\$0	\$233,483
Roofing	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Structural	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Exterior	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Interior	\$363,367	\$0	\$0	\$0	\$0	\$178,398	\$178,398	\$541,765
Mechanical	\$21,838	\$0	\$0	\$0	\$0	\$258,038	\$258,038	\$279,876
Electrical	\$32,950	\$0	\$0	\$0	\$0	\$17,911	\$17,911	\$50,861
Plumbing	\$10,510	\$0	\$0	\$0	\$0	\$0	\$0	\$10,510
Fire and Life Safety	\$11,332	\$0	\$0	\$0	\$0	\$0	\$0	\$11,332
Technology	\$586,313	\$0	\$0	\$0	\$0	\$0	\$0	\$586,313
Conveyances	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
Specialties	\$8,499	\$0	\$0	\$0	\$0	\$0	\$0	\$8,499
<b>Total</b>	<b>\$1,268,291</b>	<b>\$0</b>	<b>\$0</b>	<b>\$0</b>	<b>\$0</b>	<b>\$454,347</b>	<b>\$454,347</b>	<b>\$1,722,638</b>

\*Displayed totals may not sum exactly due to mathematical rounding


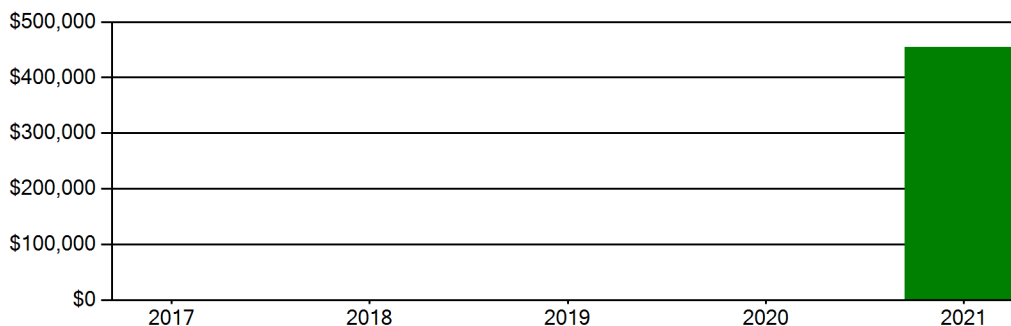


Figure 4: Life Cycle Capital Renewal Forecast



## Facility Condition Index (FCI)

The Facility Condition Index (FCI) is used throughout the facility condition assessment industry as a general indicator of a building's health. Since 1991, the facility management industry has used an index called the FCI to benchmark the relative condition of a group of schools. The FCI is derived by dividing the total repair cost, including educational adequacy and site-related repairs, by the total replacement cost. A facility with a higher FCI percentage has more need, or higher priority, than a facility with a lower FCI. It should be noted that costs in the New Construction category are not included in the FCI calculation.

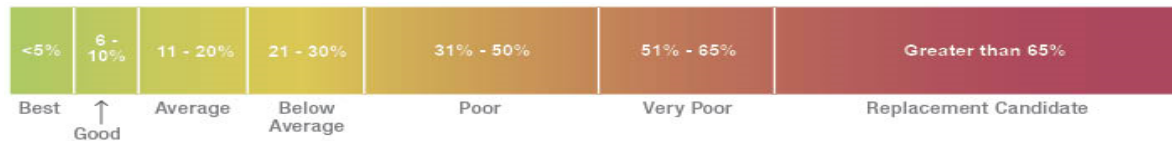

Financial modeling has shown that over a 30-year period, it is more cost effective to replace than repair schools with a FCI of 65 percent or greater. This is due to efficiency gains with facilities that are more modern and the value of the building at the end of the analysis period. It is important to note that the FCI at which a facility should be considered for replacement is typically debated and adjusted based on property owners and facility managers approach to facility management. Of course, FCI is not the only factor used to identify buildings that need renovation, replacement, or even closure. Historical significance, enrollment trends, community sentiment, and the availability of capital are additional factors that are analyzed when making school facility decisions.

For master planning purposes, the total current deficiencies and the first five years of projected life cycle needs were combined. This provides an understanding of the current needs of a facility as well as the projected needs in the near future. A 5-year FCI was calculated by dividing the 5-year need by the total replacement cost. Costs associated with new construction are not included in the FCI calculation.

The replacement value represents the estimated cost of replacing the current building with another building of like size, based on today's estimated cost of construction in the Providence, Rhode Island area. The estimated replacement cost for this facility is \$10,800,000. For planning purposes, the total 5-year need at the Blackstone Academy Charter School is \$1,722,638 (Life Cycle Years 1-5 plus the FCI deficiency cost). The Blackstone Academy Charter School facility has a 5-year FCI of 15.95%.

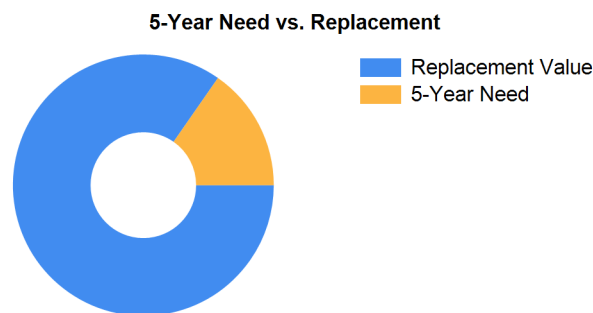


Figure 5: 5-Year FCI

It is important to reiterate that this FCI replacement threshold is not conclusive, but is intended to initiate planning discussion in which other relevant issues with regard to a facility's disposition must be incorporated. This merely suggests where conversations regarding replacement might occur.



## Rhode Island Aspirational Capacity

The capacity of a school reflects how many students the school's physical facility can effectively serve. There are various methodologies that exist to calculate capacity. It is not uncommon to review an existing building only to find that the capacity that had once been assigned is greater than what can be reasonably accommodated today. This is primarily because of a change in how programs are delivered.

The Rhode Island Aspirational Capacity is based on the Rhode Island School Construction Regulations (SCRs) and is an aspirational goal of space use. The capacity for each individual public school in the state of Rhode Island was designed to conform to Section 1.06-2 Space Allowance Guidelines of the Rhode Island Department of Education (RIDE) SCRs. These regulations outline the allowed gross square feet (GSF) per student at each school type (ES, MS, HS) by utilizing a sliding scale based on projected enrollment. The resulting capacities reflect how school capacities align to the SCRs for new construction. The existing enrollment was multiplied by the GSF per student for the appropriate bracket. For the purposes of this analysis, Pre-K centers were rolled into the elementary totals, and K-8 facilities were counted as middle schools.

The most consistent and equitable way a state can determine school capacities across a variety of districts and educational program offerings is to use square-foot-per-student standards. In contrast, in the 2013 Public Schoolhouse Assessment Report, LEAs self-reported capacities for their elementary, middle and high schools. Districts typically report "functional capacity," which is defined as the number of students each classroom can accommodate. Functional capacity counts how many students can occupy a space, not how much room students and teachers have within that space. For example, a 650-square-foot classroom and a 950-square-foot classroom can both have a reported capacity of 25 students, but the actual teaching and learning space per student varies greatly.

The variation in square feet per student impacts the kinds of teaching practices possible in each space. The lowest allocation of space per student restricts group and project-based learning strategies and requires teachers to teach in more traditional, lecture-style formats, due to a lack of space. Furthermore, the number of students that can be accommodated in a classroom does not account for access to sufficient common spaces such as libraries, cafeterias, and gymnasiums. When cafeterias are undersized relative to the population, schools must host four or more lunch periods a day, resulting in some students eating lunch mid-morning and some mid-afternoon. Similarly, undersized libraries and gymnasiums create scheduling headaches for schools and restrict student access. Finally, a classroom count-only approach to school capacity does not consider the inherent scheduling challenges schools face.

Applying the Rhode Island Aspirational Capacity, a facility of this size could ideally support an enrollment of approximately 167 students.

## Facility New Construction

As part of the Educational Program Space Assessment, select core spaces were compared to the RI School Construction Regulations. If it was determined that a facility was in need of square footage related to a cafeteria or library/media center, a cost for additional space was estimated. This cost is not included in the total 5-year need or the 5-year FCI calculation.

The New Construction cost to bring the Blackstone Academy Charter School cafeteria and/or library/media center to the size prescribed by the SCRs is estimated to be \$0.



### Summary of Findings

The Blackstone Academy Charter School comprises 30,000 square feet and was constructed in 1965. Current deficiencies at this school total \$1,268,291. Five year capital renewal costs total \$454,347. The total identified need for the Blackstone Academy Charter School (current deficiencies and 5-year capital renewal costs) is \$1,722,638. The 5-year FCI is 15.95%.

Table 4: Facility Condition by Building

	Gross Sq Ft	Year Built	Current Deficiencies	LC Yr. 1-5 Total	Total 5 Yr Need (Yr 1-5 + Current Defs)	5-Year FCI
<b>Blackstone Academy Charter School Totals</b>	<b>30,000</b>	<b>1965</b>	<b>\$1,268,291</b>	<b>\$454,347</b>	<b>\$1,722,638</b>	<b>15.95%</b>

*\*Displayed totals may not sum exactly due to mathematical rounding*

The following pages provide a listing of all current deficiencies and 5-year life cycle need and the associated costs, followed by photos taken during the assessment.

### Cost Estimating

Cost estimates are derived from local cost estimating expertise and enhanced by industry best practices, historical cost data, and relevance to the Rhode Island region. Costs have been developed from current market rates as of the 2nd quarter in 2016. All costs are based on a replace-in-kind approach, unless the item was not in compliance with national or state regulations or standards.

For planning and budgeting purposes, facility assessments customarily add a soft cost multiplier onto deficiency repair cost estimates. This soft cost multiplier accounts for costs that are typically incurred when contracting for renovation and construction services. Soft costs typically include construction cost factors, such as contractor overhead and profit, as well as labor and material inflation, professional fees, and administrative costs. Based on the Rhode Island School Construction Regulations, a soft cost multiplier of 20% is included on all cost estimates. Other project allowances are included in the cost estimates based on school attributes such as age, location, and historic designation. All stated costs in the assessment report will include soft costs for planning and budgeting purposes. These are estimates, and costs will vary at the time of construction.



## Site Level Deficiencies

### Site

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Concrete Walks Require Replacement	Capital Renewal	400	SF	3	\$8,121	16651
Install New Playground Equipment	Barrier to Accessibility	1	SF	3	\$87,771	54973
<b>Note:</b> Install New Playground Equipment						
Asphalt Paving Requires Replacement	Capital Renewal	12	CAR	4	\$39,435	16650
<b>Note:</b> Asphalt surface is cracked and weathered with some alligating.						
Backstops Require Replacement	Educational Adequacy	1	Ea.	4	\$28,329	28642
<b>Note:</b> Backstops Require Replacement						
Exterior Basketball Goals are Required	Educational Adequacy	1	Ea.	5	\$5,807	28838
<b>Note:</b> Exterior Basketball Goals are Required						
PE / Recess Playfield is Missing and is Needed	Educational Adequacy	1	Ea.	5	\$64,020	54974
<b>Note:</b> PE / Recess Playfield is Missing and is Needed						
<b>Sub Total for System</b>		<b>6</b>	<b>items</b>		<b>\$233,483</b>	
<b>Sub Total for School and Site Level</b>		<b>6</b>	<b>items</b>		<b>\$233,483</b>	

## Building: 01 - Main Building

### Interior

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Paint (probable pre-1978 in base (layers(s)) - large areas (> 10 sq. ft.) of peeling/damage & area in active use - children (measurement unit - each)	Hazardous Material	140	Ea.	4	\$39,660	Rollup
Paint (probable pre-1978 in base layer(s)) - large areas (> 10 sq. ft.) of peeling/damage & area in active use - children (measurement unit - linear feet)	Hazardous Material	120	LF	4	\$2,720	Rollup
Paint (probable pre-1978 in base layer(s)) - large areas (> 10 sq. ft.) of peeling/damage & area in active use - children (measurement unit - square feet)	Hazardous Material	1,800	SF	4	\$16,997	Rollup
Room Lighting Is Inadequate Or In Poor Condition.	Educational Adequacy	8,032	SF	4	\$303,990	Rollup
<b>Sub Total for System</b>		<b>4</b>	<b>items</b>		<b>\$363,367</b>	

### Mechanical

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Lab lacks an appropriate fume hood.	Educational Adequacy	1	Ea.	4	\$21,838	Rollup
<b>Sub Total for System</b>		<b>1</b>	<b>items</b>		<b>\$21,838</b>	

### Electrical

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Room last power shut-off valves for utilities	Educational Adequacy	1	Ea.	1	\$1,403	Rollup
Room Has Insufficient Electrical Outlets	Educational Adequacy	64	Ea.	5	\$31,547	Rollup
<b>Sub Total for System</b>		<b>2</b>	<b>items</b>		<b>\$32,950</b>	

### Plumbing

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
The Class Room Lavatories Plumbing Fixtures Are Missing And Should Be Installed	Educational Adequacy	7	Ea.	5	\$10,510	Rollup
<b>Sub Total for System</b>		<b>1</b>	<b>items</b>		<b>\$10,510</b>	

### Fire and Life Safety

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Room lacks shut-off valves for utilities. (International Fuel Gas Code, Section 409.6)	Educational Adequacy	1	Ea.	1	\$11,332	Rollup
<b>Sub Total for System</b>		<b>1</b>	<b>items</b>		<b>\$11,332</b>	

### Technology

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Room lacks Interactive White Board	Educational Adequacy	3	Ea.	3	\$16,997	Rollup



# Facility Condition Assessment

Charter - Blackstone Academy Charter School

## Technology

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Technology: Campus network switching electronics are antiquated and/or do not meet standards.	Technology	192	Ea.	3	\$90,652	24427
Technology: Instructional spaces do not have local sound reinforcement.	Technology	16	Ea.	3	\$75,544	24433
Technology: Intermediate Telecommunications Room grounding system is inadequate or non-existent.	Technology	1	Ea.	3	\$5,288	24425
Technology: Intermediate Telecommunications Room UPS does not meet standards, is inadequate, or non-existent.	Technology	1	Ea.	3	\$4,721	24426
Technology: Main Telecommunications Room ground system is inadequate or non-existent.	Technology	1	Ea.	3	\$6,610	24423
Technology: Main Telecommunications Room is not dedicated and/or inadequate.	Technology	1	Ea.	3	\$49,859	24424
Technology: Main Telecommunications Room is not dedicated. Room requires partial walls and/or major improvements.	Technology	1	Ea.	3	\$42,304	24422
Technology: Main Telecommunications Room UPS does not meet standards, is inadequate, or non-existent.	Technology	1	Ea.	3	\$8,971	24429
Technology: Network system inadequate and/or near end of useful life	Technology	10	Ea.	3	\$75,544	24431
Technology: Network system inadequate and/or near end of useful life	Technology	26	Ea.	3	\$122,758	24432
Technology: PA/Bell/Clock system is inadequate and/or near end of useful life.	Technology	30,000	SF	3	\$50,992	24430
Technology: Telecommunications Room (small size room) needs dedicated cooling system improvements.	Technology	1	Ea.	3	\$4,721	24428
Technology: Telephone handsets are inadequate and sparsely deployed throughout the campus.	Technology	16	Ea.	3	\$24,174	24434
Technology: Telephone system is inadequate and/or non-existent.	Technology	1	Ea.	3	\$7,177	24435
	<b>Sub Total for System</b>	<b>15</b>	<b>items</b>		<b>\$586,313</b>	

## Specialties

Deficiency	Category	Qty	UoM	Priority	Repair Cost	ID
Room lacks an appropriate refrigerator.	Educational Adequacy	1	Ea.	5	\$8,499	Rollup
	<b>Sub Total for System</b>	<b>1</b>	<b>items</b>		<b>\$8,499</b>	
	<b>Sub Total for Building 01 - Main Building</b>	<b>25</b>	<b>items</b>		<b>\$1,034,808</b>	
	<b>Total for Campus</b>	<b>31</b>	<b>items</b>		<b>\$1,268,291</b>	



## Blackstone Academy Charter School - Life Cycle Summary Yrs 1-5

### Building: 01 - Main Building

#### Interior

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Wall Painting and Coating	Painting/Staining (Bldg SF)	27,000	SF	\$178,398	5
<b>Sub Total for System</b>		<b>1</b>	<b>items</b>	<b>\$178,398</b>	

#### Mechanical

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
HVAC Air Distribution	Roof Top Unit - DX Gas (15 Ton)	5	Ea.	\$258,038	5
<b>Note: Bryant units</b>					
<b>Sub Total for System</b>		<b>1</b>	<b>items</b>	<b>\$258,038</b>	

#### Electrical

Uniformat Description	LC Type Description	Qty	UoM	Repair Cost	Remaining Life
Lighting Fixtures	Building Mounted Fixtures (Ea.)	12	Ea.	\$17,911	5
<b>Sub Total for System</b>		<b>1</b>	<b>items</b>	<b>\$17,911</b>	
<b>Sub Total for Building 01 - Main Building</b>		<b>3</b>	<b>items</b>	<b>\$454,348</b>	
<b>Total for: Blackstone Academy Charter School</b>		<b>3</b>	<b>items</b>	<b>\$454,348</b>	



## Supporting Photos



Spalled Sidewalk



Cracked And Weathered Parking



Site Aerial



Exterior Finishes




# Facility Condition Assessment

Charter - Blackstone Academy Charter School



Cafeteria

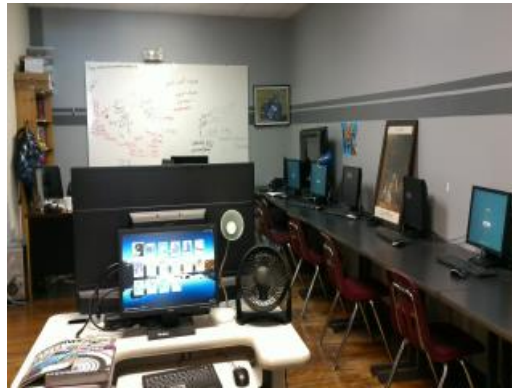

Computer Lab




Exterior



Hallway Finishes



Typical Classroom

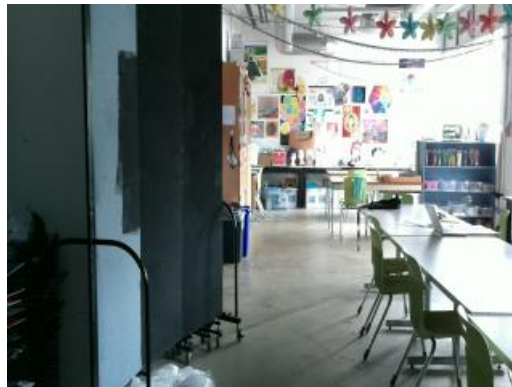

Art Room



# Facility Condition Assessment

Charter - Blackstone Academy Charter School



Front Entry